



C € GUL





Model Number


RL28-8-H-2000-IR/105/110

Background suppression sensor with 5-pin, M12 x 1 plastic connector


Features

- Ultra bright LEDs for power on and switching state
- Minimal black-white difference through the infrared transmission LED
- Not sensitive to ambient light, even with energy saving lamps
- Waterproof, degree of protection IP67
- Protection class II

Dimensions

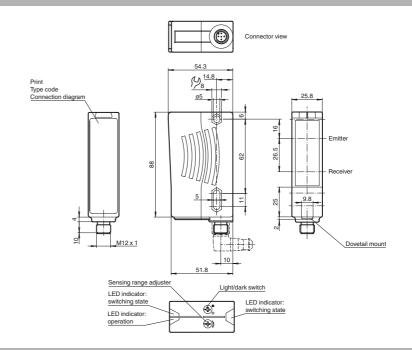

Electrical connection

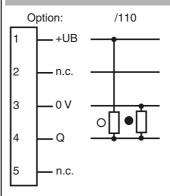

- O = Light on
- = Dark on

Pinout

Wire colors in accordance with EN 60947-5-2



1	BN	(brow
2	WH	(white
3	BU	(blue)
4	BK	(black
5	GY	(gray)

www.pepperl-fuchs.com

Technical data General specifications 20 ... 2000 mm Detection range Detection range min. 20 ... 200 mm Detection range max. 20 ... 2000 mm Background suppression max. + 10 % of the upper limit of the detection range **IRED** Light source Light type modulated infrared light, 880 nm Black/White difference (6 %/90 %) < 40 % Diameter of the light spot approx. 70 mm at a distance of 2000 mm Angle of divergence transmitter 2° receiver 2° 50000 Lux Ambient light limit Functional safety related parameters 720 a Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means LED green Operation indicator Function indicator 2 LEDs yellow ON: object inside the scanning range OFF: object outside the scanning range Control elements Sensing range adjuster, Light-on/dark-on changeover switch **Electrical specifications** Operating voltage U_{B} 10 ... 30 V DC Ripple 10 % No-load supply current I_0 ≤ 40 mA Output Switching type light/dark on switchable Signal output 1 push-pull (4 in 1) output, short-circuit protected, reverse polarity protected Switching voltage max. 30 V DC Switching current max. 100 mA Switching frequency 250 Hz f Response time Conformity EN 60947-5-2 Product standard **Ambient conditions** Ambient temperature -40 ... 60 °C (-40 ... 140 °F) Storage temperature -40 ... 75 °C (-40 ... 167 °F) **Mechanical specifications** Housing width 25.8 mm Housing height 88 mm Housing depth 54.3 mm Degree of protection IP67 Connection 5-pin, M12 x 1 connector Material Housing Plastic ABS Optical face plastic Connector plastic 70 g Approvals and certificates II, rated voltage ≤ 250 V AC with pollution degree 1-2 Protection class according to IEC 60664-1

Accessories

OMH-05

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-21

Mounting bracket

OMH-22

Mounting bracket

OMH-MLV11-K

dove tail mounting clamp

OMH-RLK29-HW

Mounting bracket for rear wall mounting

OMH-RL28-C


Weld slag cover model


Other suitable accessories can be found at www.pepperl-fuchs.com

PEPPERL+FUCHS

UL approval

E87056, cULus Listed, class 2 power supply, type rating 1

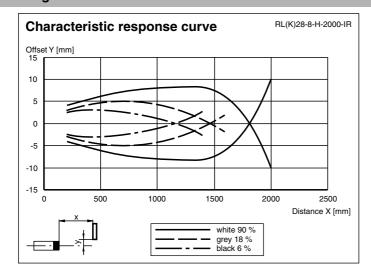

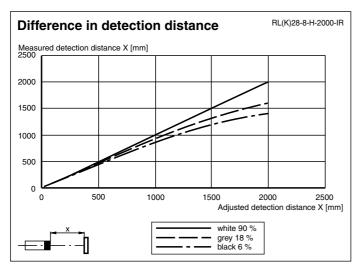

Additional information

Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

Adjustment:

After the operating voltage is applied, the LED is lit green.

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

419613_eng.xml

Date of issue: 2018-03-26